
AIP HONG KONG 22 FEB 24

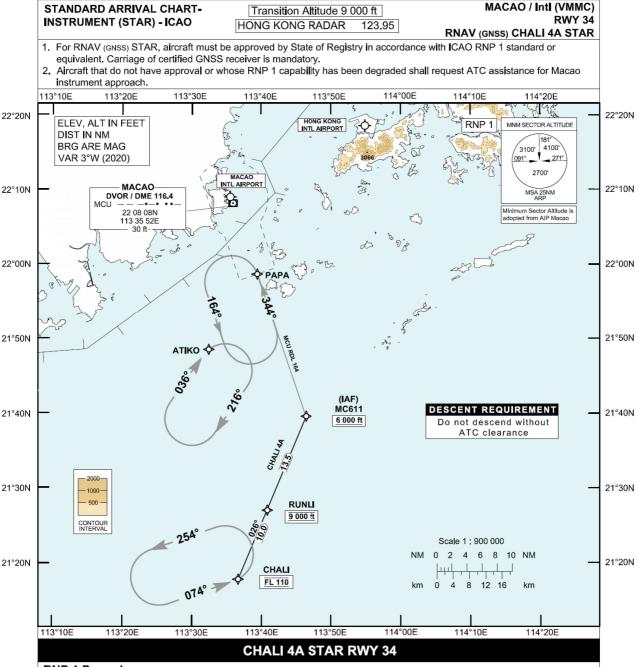

RNP 1 Procedure

(Mandate procedure available to aircraft appropriately equipped and approved)

CHALI - RUNLI - MC611

Expect ILS approach to RWY 34.

Descend as directed by ATC.

DESCENT REQUIREMENT

Cross CHALI at FL 110, RUNLI at 9 000 ft, MC611 at 6 000 ft or above.

DO NOT DESCEND WITHOUT ATC CLEARANCE.

SPEED CONTROL

Speed control shall be in force unless otherwise advised. Aircraft on STAR clearance shall fly at 250 KIAS or less whilst below FL 110.

HOLDING

The holding patterns for CHALI STAR are established at CHALI, PAPA and ATIKO. In the event of holding, each flight will be instructed individually.

In order to provide traffic management flexibility, traffic may be instructed to hold at other terminal holdings (see ENR 3.6) as directed by ATC.

LOSS OF COMMUNICATION

In the event of a loss of communication aircraft shall comply with the descent requirement and STAR track above, and carry out the appropriate approach procedure to RWY 34.

AD 2-VMMC-STAR-CHALI-A_V07_231213|h

I

FMC Database Coding Reference for Macao RNAV_(GNSS) STARs

Designator: CHALI 4A Runway 34

Serial Number	Path Descriptor	Waypoint Identifier	Fly- over	Track (°M)	Magnetic Variation	Distance (NM)	Turn Dir	Altitude (ft)	Speed (IAS)	Navigation Specification
01	IF	CHALI	-	-	+3.0	-	-	@FL110	1-	RNP 1
02	TF	RUNLI		026	+3.0	10	-	@9000	-	RNP 1
03	TF	MC611	-	026	+3.0	13.5	-	+6000	-	RNP 1

Waypoint Coordinates

Waypoint Name	Coordinates (WG584)
CHALI	21 17 45.00N
CHALI	113 36 41.00E
RUNLI	21 26 59.72N
RONLI	113 40 51.00E
MC611	21 39 36.00N
MC611	113 46 30.00E